



Bridge Failures in Alberta

Bridge Failures in Alberta




Technical Standards Branch
Class A Bridge Inspection Course




Bridge Failures in Alberta

Introduction

- Bridges are inspected for three primary reasons
 - safety of bridge system
 - maintenance of bridges
 - management of bridge system
- Inventory or management of the system can be just as important as safety and maintenance




Technical Standards Branch
Class A Bridge Inspection Course
1




Bridge Failures in Alberta

Need to Know

- Which bridges are:
 - substandard and not adequate to carry full legal loads
 - susceptible to flooding
 - high priority for replacement




Technical Standards Branch
Class A Bridge Inspection Course
2




Bridge Failures in Alberta

Causes of Failure

- 70% of failures are caused by factors related to water flow
 - scouring of piers
 - undermining of the support elements
- Structural failure
 - element failure due to excess load or material deterioration
- Lack of knowledge or good judgment
 - Operation
 - Construction
 - design




Technical Standards Branch
Class A Bridge Inspection Course
3



Bridge Failures in Alberta

Contributing Factors


- Structural engineering is a science
 - applied truckloads are known
 - material behavior is known and can be accurately predicted
 - everything can be accurately calculated and predicted
- River engineering is more of an art
 - the effects of a flood cannot simply be calculated
 - the effects of Mother Nature are not easily predicted
 - the velocity and angle of flow, the duration of flooding, etc.

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
4


Bridge Failures in Alberta

Bear Creek on 84 Ave in Grande Prairie

- SPCSP HE 5.5 x9m
- Installed in 1973
- Total collapse of structure in 1988
- No inspection after installation

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
5


Bridge Failures in Alberta

Bear Creek on 84 Ave in Grande Prairie




Structure on 84 Avenue in Grande Prairie


Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
6


Bridge Failures in Alberta

Bear Creek on 84 Ave in Grande Prairie



Total collapse of culvert. Only headwall intact

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
7


Bridge Failures in Alberta

Bear Creek on 84 Ave in Grande Prairie



Inside of collapsed culvert


Technical Standards Branch
Class A Bridge Inspection Course

8



Bridge Failures in Alberta



Bear Creek on 84 Ave in Grande Prairie



Outlet of culvert

Technical Standards Branch
Class A Bridge Inspection Course

9



Bridge Failures in Alberta

Bear Creek on 84 Ave in Grande Prairie



Backfill characteristics

Technical Standards Branch
Class A Bridge Inspection Course

10



Bridge Failures in Alberta

Bear Creek on 84 Ave in Grande Prairie



Water and sewer line in embankment

Technical Standards Branch
Class A Bridge Inspection Course

11



Beaver Ranch Creek on Hwy 58 East of Vermilion

- SPCSP HE 4.8 x 7.3
- Installed in fall of 1987
- Extensive deformation in 1988
- Total collapse in 1989 while fill being removed for repair of culvert



Technical Standards Branch
Class A Bridge Inspection Course

12



Beaver Ranch Creek on Hwy 58 East of Vermilion



Outlet showing intact end treatment



Technical Standards Branch
Class A Bridge Inspection Course

13



Beaver Ranch Creek on Hwy 58 East of Vermilion



Inlet with culvert still connected to headwall



Technical Standards Branch
Class A Bridge Inspection Course

14



Beaver Ranch Creek on Hwy 58 East of Vermilion



Overview of culvert inlet



Technical Standards Branch
Class A Bridge Inspection Course

15



Weed Creek on Highway 39 Near Thorsby

- Arch culvert
- Constructed in 1960
- Washed out July 3rd, 1990.



Technical Standards Branch
Class A Bridge Inspection Course

16



Weed Creek on Hwy 39 Near Thorsby



Concrete arch culvert in 1989



Technical Standards Branch
Class A Bridge Inspection Course

17



Weed Creek on Hwy 39 Near Thorsby



Water on U/S end up to shoulder of road



Technical Standards Branch
Class A Bridge Inspection Course

18



Weed Creek on Hwy 39 Near Thorsby



Hole in side slope on d/s side



Technical Standards Branch
Class A Bridge Inspection Course

19



Bridge Failures in Alberta

Weed Creek on Hwy 39 Near Thorsby



Water now coming out of d/s fill

Alberta Government Technical Standards Branch
Class A Bridge Inspection Course
20 

Bridge Failures in Alberta

Weed Creek on Hwy 39 Near Thorsby



Road gone

Alberta Government Technical Standards Branch
Class A Bridge Inspection Course
21 

Bridge Failures in Alberta

Weed Creek on Hwy 39 Near Thorsby



Upstream inlet

Alberta Government Technical Standards Branch
Class A Bridge Inspection Course
22 

Bridge Failures in Alberta

Weed Creek on Hwy 39 Near Thorsby



d/s outlet

Alberta Government Technical Standards Branch
Class A Bridge Inspection Course
23 

Weed Creek on Hwy 39 Near Thorsby



Centre section of culvert




Technical Standards Branch
Class A Bridge Inspection Course

24



Weed Creek on Hwy 39 Near Thorsby

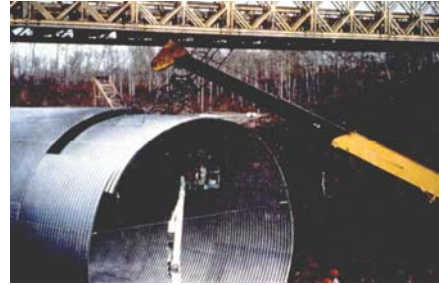

Erecting 8.5 m SPCSP



Technical Standards Branch
Class A Bridge Inspection Course

25



Weed Creek on Hwy 39 Near Thorsby



u/s inlet of new culvert



Technical Standards Branch
Class A Bridge Inspection Course

26



BF 77496 – Hwy. 40 over Lineham Creek in Kananaskis

- 4.3M diameter Structural Plate Ellipse (SPE) culvert installed in 1983.
- 53M invert length.
- 9.1M road to streambed height.
- Washed out during 2013 flood event.




Technical Standards Branch
Class A Bridge Inspection Course





Bridge Failures in Alberta

BF 77496 – Looking D/S at scale of washout (30m wide vs. 4.3M pipe).



Technical Standards Branch
Class A Bridge Inspection Course



Bridge Failures in Alberta

BF 77496 – Drift blockage across inlet and heaved barrel.



Technical Standards Branch
Class A Bridge Inspection Course



Bridge Failures in Alberta

BF 77496 – Inlet blockage and barrel heave



Technical Standards Branch
Class A Bridge Inspection Course



Bridge Failures in Alberta

BF 77496 – Outlet and barrel floor folded and heaved nearly to roof




Technical Standards Branch
Class A Bridge Inspection Course





Bridge Failures in Alberta

BF 77496 – Replaced in 2015 with new 8-14-8 M SLW girder bridge



Technical Standards Branch
Class A Bridge Inspection Course





Bridge Failures in Alberta


Red Willow River on Local Road near Rio Grande

- 150' through truss built in 1927
- Bridge posted for 17 tons
- Bridge collapsed 1977
- Failure of rotten abutment corbel

Technical Standards Branch
Class A Bridge Inspection Course




33




Bridge Failures in Alberta

Red Willow River on Local Road near Rio Grande




Collapsed bridge

Technical Standards Branch
Class A Bridge Inspection Course




34




Bridge Failures in Alberta

Red Willow River on Local Road near Rio Grande




Abutment end of bridge showing timber deck etc.

Technical Standards Branch
Class A Bridge Inspection Course




35



Bridge Failures in Alberta

Red Willow River on Local Road near Rio Grande



Abutment end of truss dropped and buckled the bottom chord



Technical Standards Branch
Class A Bridge Inspection Course


36



Bridge Failures in Alberta


Castle River Bridge on Local Road West of Pincher Creek

- built in 1951 designed by consultant in Toronto
- Concrete T girder poor condition in 1961
- replaced in 1981




Technical Standards Branch
Class A Bridge Inspection Course

37




Bridge Failures in Alberta

Castle River Bridge on Local Road West of Pincher Creek




Recorded crack pattern in 1964




Technical Standards Branch
Class A Bridge Inspection Course

38




Bridge Failures in Alberta

Castle River Bridge on Local Road West of Pincher Creek




Bridge condition in 1979 (28 years old)




Technical Standards Branch
Class A Bridge Inspection Course

39




Bridge Failures in Alberta

Castle River Bridge on Local Road West of Pincher Creek




Shear crack in girder and efflorescence from cracks

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
40




Bridge Failures in Alberta

Castle River Bridge on Local Road West of Pincher Creek



Shear crack at girder end

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
41



Bridge Failures in Alberta

Castle River Bridge on Local Road West of Pincher Creek




Removing bridge in August 1980

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
42




Bridge Failures in Alberta

Castle River Bridge on Local Road West of Pincher Creek



Bridge down

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
43



Castle River Bridge on Local Road West of Pincher Creek



Bridge remains



Technical Standards Branch
Class A Bridge Inspection Course

44



Simonette River Bridge on Forestry Trunk Road (South of Debolt)

- Timber and Bailey built in 1960 deck to s/b 3m
- 1982, 2 through trusses 60.96m 9m deck to s/b
- Washed out in 1987 (Tornado Flood)
- Rebuilt in 1988



Technical Standards Branch
Class A Bridge Inspection Course

45



Simonette River Bridge on Forestry Trunk Road (South of Debolt)



Forestry bridge built in 1960, 380 ft. long bridge



Technical Standards Branch
Class A Bridge Inspection Course

46



Simonette River Bridge on Forestry Trunk Road (South of Debolt)



Forestry Double Bailey, chord reinforced 2 @ 100 ft.




Technical Standards Branch
Class A Bridge Inspection Course

47




Bridge Failures in Alberta

Simonette River Bridge on Forestry Trunk Road (South of Debolt)




Bridge built in 1982, 122m bridge

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
48




Bridge Failures in Alberta

Simonette River Bridge on Forestry Trunk Road (South of Debolt)




Forestry road with river in flood, 1987

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
49




Bridge Failures in Alberta

Simonette River Bridge on Forestry Trunk Road (South of Debolt)




Truss partly under water

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
50




Bridge Failures in Alberta

Simonette River Bridge on Forestry Trunk Road (South of Debolt)




Drift jamming under bridge

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
51




Bridge Failures in Alberta

Simonette River Bridge on Forestry Trunk Road (South of Debolt)



Bridge floating and starting to shift

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
52



Bridge Failures in Alberta

Simonette River Bridge on Forestry Trunk Road (South of Debolt)




Bridge starting to move laterally

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
53




Bridge Failures in Alberta

Simonette River Bridge on Forestry Trunk Road (South of Debolt)



Bridge floating downstream

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
54



Bridge Failures in Alberta

Simonette River Bridge on Forestry Trunk Road (South of Debolt)



One span tipped in middle channel and other one around near shore

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
55



Simonette River Bridge on Forestry Trunk Road (South of Debolt)



Bridge gone



Technical Standards Branch
Class A Bridge Inspection Course

56



Simonette River Bridge on Forestry Trunk Road (South of Debolt)



New bridge



Technical Standards Branch
Class A Bridge Inspection Course

57



Beaverhill Creek on Local Road North of Lamont

- 3-28' Precast Concrete
- Constructed in 1959
- North pier cap failure in August 1980



Technical Standards Branch
Class A Bridge Inspection Course

58



Beaverhill Creek on Local Road North of Lamont



Local road with gravel truck pup remaining on bridge



Technical Standards Branch
Class A Bridge Inspection Course

59



Bridge Failures in Alberta

Beaverhill Creek on Local Road North of Lamont



Pup tandem axle in hole left by dropped girder

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
60



Bridge Failures in Alberta

Beaverhill Creek on Local Road North of Lamont



Sheared timber cap. One girder hung up on pile.

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
61



Bridge Failures in Alberta

Beaverhill Creek on Local Road North of Lamont



Failed pier cap

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
62



Bridge Failures in Alberta

Beaverhill Creek on Local Road North of Lamont



Failed pier cap with girder dropped to pile top level

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
63



Bridge Failures in Alberta

Beaverhill Creek on Local Road North of Lamont



Bottom of cap with piles punching (North pier)

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
64




Bridge Failures in Alberta

Little Smoky Bridge on SH 744


- Constructed in 1954
- 150 span failed in 1980 by cat and blade on high boy

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
65




Bridge Failures in Alberta

Little Smoky Bridge on SH 744




**Severed
batter post
U7 - L8**

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
66




Bridge Failures in Alberta

Little Smoky Bridge on SH 744



**Broken hanger
U7 - L7 and
first diagonal
U7 - L6**

Alberta Government
Technical Standards Branch
Class A Bridge Inspection Course
67



Bridge Failures in Alberta

Little Smoky Bridge on SH 744



Members L6 - U5 and U5 - L5 buckled




Technical Standards Branch
Class A Bridge Inspection Course
68




Bridge Failures in Alberta


Little Smoky Bridge on SH 744



Inside of truss, sagged 2' -0" leaning 10"




Technical Standards Branch
Class A Bridge Inspection Course
69




Bridge Failures in Alberta

BF 1153 – Hwy. 22 over Oldman River near Lundbreck

- 3 span Type PO girders on concrete substructure -built 1959.
- Span lengths of 20.7 – 29 – 29 M.
- Typ. Sliding Plate Bearing with Self-Lubricating Bronze Plates.
- Expansion Bearings at P1 and P3. Deck height is 18.5M.
- Routine Level 1 BIM inspection of December 2015 noted frozen bearings at the west end of P1 under Span 1 - G1 and G2.
- Significant portion of concrete pier cap under G1, G2 bearings had failed due to induced stresses into pier from frozen bearings resulting in G1 un-supported and near collapse.
- Lane above immediately closed and truck traffic detoured.
- Subsequent BIM Advisory bulletin #3 issued January 20, 2016.





Technical Standards Branch
Class A Bridge Inspection Course




Bridge Failures in Alberta

BF 1153 – Standard Drawing S-701

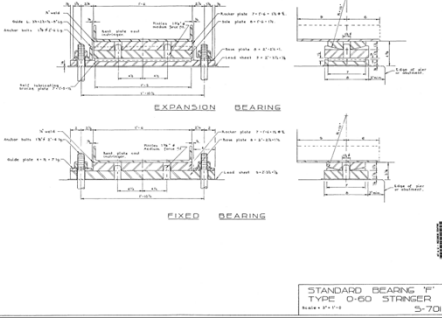




Technical Standards Branch
Class A Bridge Inspection Course



Bridge Failures in Alberta

BF 1153 – Failed concrete at west end of P1 from frozen bearings under G1, G2.




Technical Standards Branch
Class A Bridge Inspection Course


Alberta Government 

Bridge Failures in Alberta

BF 1153 – Failed pier concrete and unsupported bearing under Sp. 1-G1.




Technical Standards Branch
Class A Bridge Inspection Course


Alberta Government 

Bridge Failures in Alberta

BF 1153 – 30mm drop in rail and curb over Sp.1-G1.



Technical Standards Branch
Class A Bridge Inspection Course

Alberta Government 

Bridge Failures in Alberta

Questions??



Technical Standards Branch
Class A Bridge Inspection Course

Alberta Government 